



Thank you for purchasing a ZTechnik product. Read these instructions carefully and thoroughly before beginning work. Dealers, if installing this windscreen for a customer, please give them this manual. It contains information needed to properly maintain and use this product.



Attention:

Special notes and cautionary measures which can prevent damage to the accessory or motorcycle.

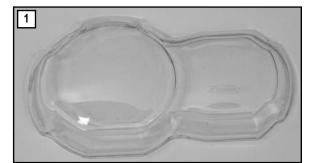

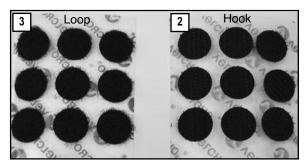



Tips for facilitation of operation, control and adjustment, as well as maintenance work.

CONTENTS OF KIT

Item	Description	Part No.	Qty.
1	Headlight Guard with Quantum® Hardcoat		1
Bag#	1154	eadlight Guard with Quantum® Hardcoat 1 54 elcro Hook 77-771159-000 9	
2	Velcro Hook	77-771159-000	9
3	Velcro Loop	77-771160-000	9

TOOLS REQUIRED: T10 Torx Grease Pencil or Crayon



PREPARATION

The Velcro® Industrial grade fasteners will securely hold your Quantum Hardcoated Polycarbonate Headlight Cover to the motorcycle's headlight.

For best performance and adhesion the Headlight Cover and motorcycle surface should be a minimum of 65 °F (18 °C)

Cleaning is critical. Be sure to clean the headlight rim and remove all wax, cleaners, and protectants (Armor-All). These can contaminate the adhesive causing it to fail.



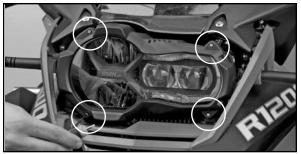


Figure 1



Figure 2



Figure 3

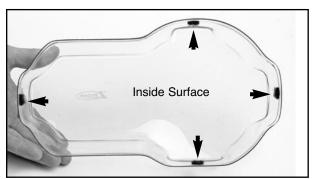


Figure 4



Figure 5

INSTALLATION

1. For ease of installation, it is recommend to remove the Headlight Rim. **(T10Torx) Figure 1**

2. Apply 4 pieces of Velcro Loop to Rim. Position Velcro Dot at inside edge of Rim as shown in inset. **Figure 2**

3. Align the Headlight Cover to Rim. Make 4 marks on the *outside* of the Guard where the Hook will match to the Loop. **Figure 3 (Grease Pencil)**

4. Install Hook at the mark on the *inside* of the Guard. Press down to ensure good contact of adhesive with Guard. **Figure 4**

Let Velcro Hook and Loop cure for 5 minutes before installing Headlight Guard.

5. Re-install Rim to motorcycle. (T10 Torx)

6. Install Guard. Align Loop fastener with Hook and press into place until fully engaged. Wipe marks from Guard. **Figure 5**

CLEANING AND MAINTENANCE

To clean the guard, wash with a clean soft cloth, plenty of warm water and if necessary, a non-abrasive soap such as dishwashing liquid. Flannel or soft chamois make good cleaning cloths. Paint, glue residue or tar removal: Moisten cotton with naphtha or turpentine **followed by a wash as above.**

Do not clean the guard with abrasive cleaners, alcohol, or strong solvents. Except as recommended above for paint, glue, or tar removal.

 ZTechnik
 PO Box 158 Maywood, IL
 60153-0158
 USA

 708-343-0400
 / Fax: 708-343-0625
 / www.ztechnik.com / e-mail: info@ztechnik.com

 Page 2 of 2
 10-119993-000
 05/16 Rev A 05/18